350F #2 6/24/74

MOTORCYCLE SERVICE DEPARTMENT

CAM CHAIN TENSION ADJUSTMENT TIGHTENING TORQUE

When performing cam chain tension adjustment, retighten the tension plunger set bolt ① to 80 - 100 kg-cm (69.4 - 86.8 lb. in.). Tighten the lock nut ① securely, but do not apply excessive force.

CAUTION: Excessive tightening torque may deform the crankcase threads, resulting in thread damage, bolt seizure, and breakage when the bolt is subsequently loosened for readjustment.

- Tension plunger set bolt
- 1 Lock nut

BOLT TIGHTENING TORQUE: 80 - 100 kg-cm (69.4 - 84.8 lb. in.)

> AMERICAN HONDA MOTOR CO., INC. MOTORCYCLE SERVICE DEPARTMENT

@ American Honda Motor Co., Inc. 1974

ROUTING:

COPY 1

COPY 2

GENERAL MANAGER SERVICE MANAGER

SALES DEPT.

OFFICE FILE

☐ MECHANICS

SHOP MANUAL