

HONDA



SERVICE BULLETIN

AMERICAN HONDA MOTOR CO., INC. MOTORCYCLE SERVICE DEPARTMENT

1980 CB650 ACCELERATION PERFORMANCE

SYMPTOM

Poor initial response when the throttle is suddenly opened while running at high rpm.

PROBABLE CAUSE

Rich fuel mixture due to excessive pressure differential between each venturi and externally vented float chamber.

MOTORCYCLES AFFECTED

A few 1980 CB650 and CB650C motorcycles in the following range may have an acceleration performance problem – most will have normal performance.

Engine serial number range: 2100001 through 2119684

CORRECTIVE ACTION

If the customer experiences this acceleration performance problem, install air cleaner cover set, P/N 17225-460-670, which replaces the original float chamber vent tubes with tubes that vent the float chambers into the air cleaner case.

Route the new vent tubes as shown on page 2.

WARRANTY INFORMATION

The standard warranty time and mileage apply – there is no extension of coverage. Use the following claims information:

Defect Code: 080

Labor Time: 0.1 hour

PARTS INFORMATION

Submit a regular parts order for the quantity needed.

H/C	PART NUMBER	DESCRIPTION
095789	17225-460-670	Air Cleaner Cover Set

MTB 1983 8008

ROUTING:

COPY 1

GENERAL MANAGER

SALES DEPT.

OFFICE FILE



COPY 2

SERVICE MANAGER

MECHANICS

SHOP MANUAL

AIR CLEANER COVER SET INSTALLATION AND ROUTING

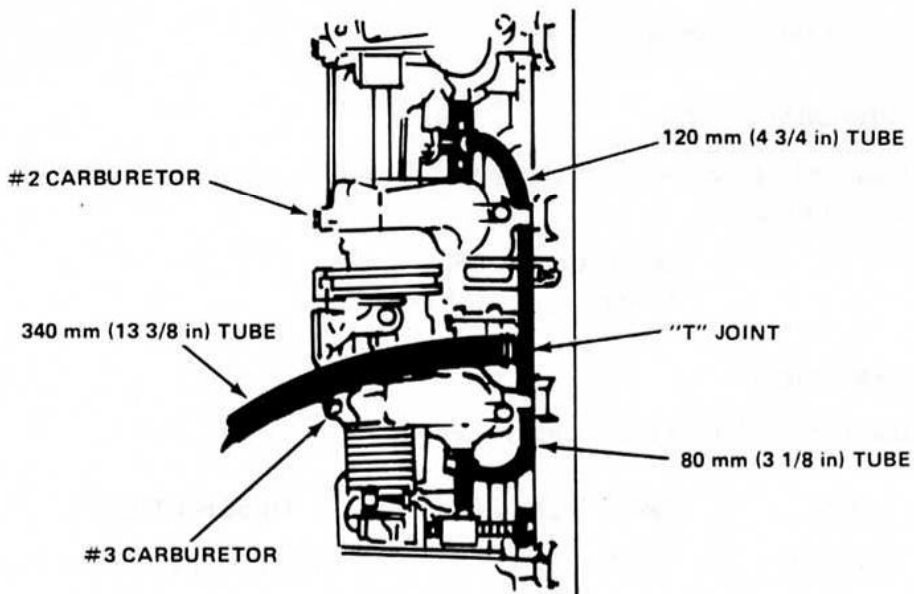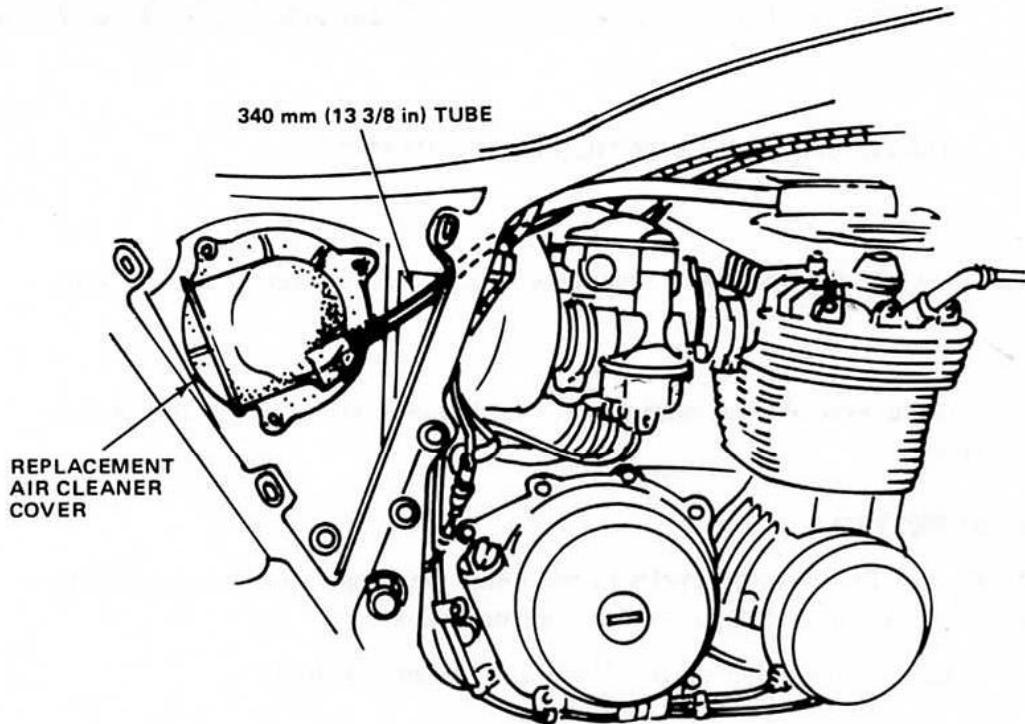

AMERICAN HONDA MOTOR CO., INC.
SERVICE DEPARTMENT