

# HONDA



# SERVICE BULLETIN


AMERICAN HONDA MOTOR CO., INC.

MOTORCYCLE SERVICE DEPARTMENT

500 #2  
7/22/71

## OIL PUMP SERVICING PRECAUTION

After servicing the CB-500 oil pump, use extreme care during installation of the oil pressure relief valve cap, Part Number 15331-323-003, to avoid overtightening the cap.

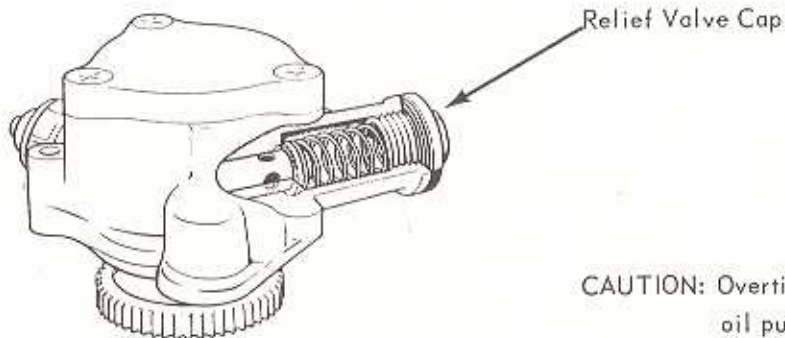

CAUTION: Overtightening may fracture oil pump cap.

Correct oil pressure valve cap tightening torque is 7.2-10 ft.lbs. (1.0-1.4 Kg.m.).

9-745

AMERICAN HONDA MOTOR CO., INC.  
Motorcycle Service Department

### ROUTING:

COPY 1  
COPY 2

GENERAL MANAGER  
 SERVICE MANAGER

SALES DEPT  
 MECHANICS

OFFICE FILE  
 SHOP FILE